

Four Car Garage, Inc.
 609 California Drive
 Burlingame, Ca. 94010
 Phone - 650-342-1406 Fax - 650-347-8948
 Mercedes * BMW *Jag * Rover * Bentley * Rolls Royce * Mini

INVOICE
24787
 Org. Est. # 028111
 EPA ID # CAL 000032270
 Ca. BAR # AG148445

INVOICE

Print Date : 09/22/2014

1988 BMW - M5
 3.5L, In-Line6, VIN (3)
 Lic # : 7HEA628 Odometer In : 173874
 Unit # :
 Vin # : **WBSDC9308J2875317**
 Hat # :

Cust ID : 4646 Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
---------------------------	-----	------	----------	-------------------	----------

Reference sensor 12 14 1 708 618	2.00	81.27	162.54	***Discount*** \$250.00 off labor	
-------------------------------------	------	-------	--------	--------------------------------------	--

Vehicle is being towed in due to a no-start condition. 250.00
 Please check and report.
 Customer indicates that this is a fairly new to him, sight unseen, purchase. We checked the engine oil and it looks fresh. Brake fluid looks fresh. We do notice that the drive belts are cracked. We did not perform a complete inspection on the vehicle; just commented on what was obvious to us.

Replace reference sensor. 429.00
 We confirmed there is no spark coming out of the coil. We confirmed that there was power to the coil, but had no reference signal. We went to the reference sensor connector and found it broken and had vibrated loose. This sensor is wrapped in a sheath along with the speed sensor. We need to unwrap them and install a new reference sensor and loom. Jason requested we install the other sensor at this time since there is no additional labor.

REGULATION (99550) TO REDUCE GREENHOUSE EMISSIONS FROM VEHICLES WITH UNDER INFLATED TIRES. THIS REGULATION REQUIRES TIRES (NOT THE SPARE) TO BE CHECKED DURING ANY AUTOMOTIVE MAINTENANCE OR REPAIR. N/C

IN OUT IN OUT
 LF 23 36 RF 22 36
 LR 22 41 RR 22 41

**** Recommendations ****
 The drive belts are cracked.

Four Car Garage, Inc.
 609 California Drive
 Burlingame, Ca. 94010
 Phone - 650-342-1406 Fax - 650-347-8948
 Mercedes * BMW * Jag * Rover * Bentley * Rolls Royce * Mini

INVOICE
24787
 Org. Est. # 028111
 EPA ID # CAL 000032270
 Ca. BAR # AG148445

INVOICE

Print Date : 09/22/2014



1988 BMW - M5
 3.5L, In-Line6, VIN (3)
 Lic # : 7HEA628 Odometer In : 173874
 Unit # :
 Vin # : **WBSDC9308J2875317**
 Hat # :

Cust ID : 4646 Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
---------------------------	-----	------	----------	-------------------	----------

[Technicians : Kaldor, Gary; Kaldor, David; Please Select, Technician]

Org. Estimate	Revisions	Current Estimate	Additional Cost	Revised Estimate	
\$0.00	\$606.17	\$ 606.17			
<small>Ok to replace crank sensors Rhee, Jason Customer Called In 09/22/2014 - 1:25 Kaldor, Diane Parts: \$162.54 Labor: \$429.00 Sublet: \$0.00 Taxes & Fees: \$14.63</small>					Labor: 679.00 Parts: 162.54 Sublet: 0.00 Discount: -250.00 Sub: 591.54 Tax: 14.63 Total: 606.17 Bal Due: \$606.17
[Payments -]					

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....