Four Car Garage, Inc. 1007 Rollins Road Burlingame, Ca. 94010 Phone - 650-342-1406 Fax - 650-347-8948 Mercedes * BMW *Jag * Rover * Bentley * Rolls Royce * Mini

INVOICE

25318

Org. Est. # 030225 EPA ID# CAL000409885 Ca. BAR # AG148445

INVOICE

1988 BMW - M5

3.5L, In-Line6, VIN (3)

Lic #: 7HEA628

Odometer In: 178365

Print Date: 10/01/2015

						110000				
		Unit #:								
0110		m .c.u			Vin #: WBSDC9308J2875317					
Cust ID : 4646		Ref # :		Hat # :						
Part Description	on / Number	Qty	Sale	Extended	Labor Description	Extended				
Starter motor/rebuilt					Vehicle towed in. Customer indicates that a valet was	N/C				
12 41 1 466 093		1.00	184.50	184.50	returning the car to him and he had to turn it off					
Rubber boot					because there was smoke coming from the vents.					
11 61 1 306 790		6.00 15.20 91.20			After that it would not crank. Check and report.					
vent hose					Diagnostic applied to repair.					
11 15 1 306 958		1.00	22.90	22.90	We found that the starter motor has failed.	528.00				
Hose to IAC					We can see a burned electrical wiring connector at					
13 41 1 310 699		1.00	51.07	51.07	the starter motor, so quite possibly if failed					
fuel hose					internally. We would need to remove the plenum to					
13 31 1 722	2 565	1.00	37.65	37.65	access the starter. The two hoses that come out of					
Electrical connector					the plenum are as hard as rocks, so we will want to					
Part		1.00	9.75	9.75	replace them. Also, we can see the first plenum					
					boot is cracked. so would antiicipate the others					
					being in the same condition. We would replace all					
					six. We need to replace the starter with a rebuilt					
					unit and a new electrical connector to the starter.					
					Note: We were unable to set the clock and date and					
					the radio is coded. Jason says he will take care of					
					this himself.					
					Jason comments that there is a rumbling in the	N/C				
					driveline.					
					Technician says it is not as bad as many that have					
					come in. We would need to remove the driveline					
					and send it out to have a new u-joint installed and					
					staked, new center support bearing and then					
					balanced.					
					REGULATION (99550) TO REDUCE	N/C				
					GREENHOUSE EMISSIONS FROM VEHICLES					
					WIH UNDER INFLATED TIRES. THIS					
					REGULATION REQUIRES TIRES (NOT THE					
					SPARE) TO BE CHECKED DURING ANY					
					AUTOMOTIVE MAINTENANCE OR REPAIR.					
					IN OUT IN OUT					
					LF <u>27 36</u> RF <u>24 36</u>					
					LR <u>34 41 RR 33 41</u>					
					**** Recommendations ****					
					The drive belts are cracked.					

Four Car Garage, Inc. 1007 Rollins Road

Burlingame, Ca. 94010 Phone - 650-342-1406 Fax - 650-347-8948 Mercedes * BMW *Jag * Rover * Bentley * Rolls Royce * Mini INVOICE

25318

Org. Est. # 030225 EPA ID# CAL000409885 Ca. BAR # AG148445

INVOICE						Print Date: 10	0/01/2015
Cust ID: 464	46	Ref#:		1988 BMW - M5 3.5L, In-Line6, VIN Lic #: 7HEA628 Unit #: Vin #: WBSDC9 Hat #:	3	Odometer In :	: 178365
Part Description / Num	ber Qty	Sale	Extended	Labor Description			Extended
[Technicians : Kaldor, David							
Org. Estimate \$0.00 Ok to rpl starter & assoc hoses. Rhee	Revisions \$960.81		Estimate \$ 96		Revised Estimate	- Laboi.	528.00
Parts: \$397.07 Labor: \$528.00	Sublet: \$0.00 Taxes & Fees: \$35.	74		\$960.81	\$960.81	Parts: Sublet:	397.07 0.00
[Payments -] I hereby authorize the ab	ove repair work to be d	one along	with the nec	essary material and herel	by grant you and/	Sub: Tax: Total: Bal Due:	925.07 35.74 960.81 \$960.81
permission to operate the	car of truck herein des	cribed on	street, highw	vays or elsewhere for the	purpose to testing	g and/or inspect	ion. An

SIGNATURE..... Date...... Time..... Written By: Kaldor, Diane Page 2 of 2 01.17.07 Copyright Mitchell 1 Invoic1

repair.

express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of